



ATTO Technology, Inc.

Product Release Notes

Celerity 16Gb Fibre Channel Multipath Director™ Release v1.20MP – Mac OS® X

1. General Release Information

These product release notes define the new features, changes, known issues and release details that apply to the Celerity 16Gb Fibre Channel adapter product v1.20MP that was released on 3/24/2014. This information pertains to the Mac OS X 10.6, 10.7 and 10.8.

2. Changes

- **Version 1.20MP (Released 3/24/2014)**
 - **Note:** It is recommended that firmware dated 11/08/2012 be utilized with this driver release.
 - **New Features**
 - Expanded diagnostic output tools.
 - Feature added to allow user driven rescanning of all paths to devices.
 - Feature added allowing a path to be a member of two path sets at one time for devices that change identifiers in VPD. Supported with Config Tool 4.14 and later.
 - Corrected a kernel panic that may occur when unloading a driver.
 - Resolved issues with execution throttle.

- **Version 1.15MP (Released 2/06/2014)**
 - **Note:** It is recommended that firmware dated 11/08/2012 be utilized with this driver release.
 - **New Features**
 - Corrected an issue with path discovery for paths that are deactivated immediately after being found.
 - Addressed an issue with deactivating paths that are disabled due to I/O errors.
 - Fixed an issue where discovery or failover of a path could be delayed by a transitioning asymmetric access state for a port group that did not apply to the path.
 - Resolved an issue where simultaneously reporting device changes on multiple HBA channels could result in the multipathed devices from being activated
 - Addressed an issue where path selection could prematurely fail an I/O when the last remaining path failed simultaneously
 - Corrected an issue where path rediscovery would not activate the path after the link down timeout previously expired
 - Paths that have a scan pending are considered retrying so I/O is suspended when no paths are active.
 - Feature added to allow path activations and deactivations during the link down timeout period to coordinate with other device events to prevent invalid path states.
 - Added PCIe pause support for Thunderbolt hot plugging in OS X 10.9.
 - **Supported OS**
 - Mac OS X 10.9
 - Mac OS X 10.8
 - Mac OS X 10.7
 - Mac OS X 10.6

- **Version 1.03MP (Released 6/27/2013)**

- **Note:** It is recommended that firmware dated 11/08/2012 be utilized with this driver release.
- **New Features**
 - Corrected an issue where I/O could be stopped to a device after a link goes down.
- **Version 1.02MP (Released 4/10/2013)**
 - **Note:** It is recommended that firmware dated 11/08/2012 be utilized with this driver release.
 - **New Features**
 - Added '—m' option with the same functionality as the standard driver.
 - Corrected out of resource processing when the mapped controller and destination controller for an I/O are different.

- **Version 1.01MP (Released 1/15/2013)**
 - **Note:** It is recommended that firmware dated 11/08/2012 be utilized with this driver release.
 - **New Features**
 - Changed the default Execution Throttle to 255 (disabled).
 - Implemented interrupt coalescing.
 - Fixed event Log messages so lost frames report with the correct error code.
 - Corrected an issue that could result in devices not being found after waking from sleep.
 - Corrected target identifier determination for certain arrays.
 - Disabled multipathing for certain arrays that do not report proper device identification.

- **Version 1.00MP (Released 11/08/2012)**
 - **Note:** It is recommended that firmware dated 11/08/2012 be utilized with this driver release.
 - **New Features**
 - Initial release of Mac OS X multipathing drivers for the Celerity 16Gb FC adapters.
 - **Supported OS**
 - Mac OS X 10.6
 - Mac OS X 10.7
 - Mac OS X 10.8

3. Known Issues/Advisements

- Multiple direct connections to a Xyratex drive array do not work.
- Celerity quad-channel (FC-164E) is not supported on Mac operating system.

4. Affected Products

Product Name	SKU
Celerity FC 161E	CTFC-161E-000
Celerity FC 162E	CTFC-162E-000

Contacting ATTO Support

ATTO Technology, Inc. is renowned for its technical support services. ATTO's goal is to provide you the quickest response possible for your technical support needs, and is available Monday-Friday, 8:00 AM to 6:00 PM EST (except holidays and plant closings).

ATTO Technical Support can be contacted via phone or email:

- Phone: 716.691.1999 ext. 242
- E-Mail: techsupport@attotech.com