



XstreamCORE FC 7500 Firmware Release v2.20

1. General Release Information

These product release notes define the features, known issues and release details that apply to the XstreamCORE FC 7500 Storage Controller version 2.20 firmware that was released on 10/19/2017.

2. Introduction

- **Version 2.20 (Released 10/19/17)**
 - **Release details**
 - *This release adds new improvements and fixes made during XstreamCORE product line development and testing. Increased stability and clean-up of incidents reported in the field are primary benefits of this release.*
 - **New and updated features**
 - *Added support for tape and optical (DVD) passthrough devices*
 - *Added legacy UVDA software SpeedWrite support for tape devices*
 - *Updated BAU 26 to BAU 27*
 - *Fixed ACB command count issue in the HCE for data/status phases of read completions with data and error status*
 - *Added disable error data response option to the TCE, allowing it to send error status with data directly to the BCE*
 - **Incident Fixes**
 - *Fixed command/SAS activity LED behavior in valid SAS dual-path scenarios (IR17354)*
 - *Fixed SNMPTrapAddress feature in GUI to allow only IPv4 addresses (IR17412)*
 - *Fixed CLI processing for displaying immediate command help text (UVDA IR17898) (IR17747)*
 - *Fixed intermittent ability to send CLI commands through KiTTY telnet client (UVDA IR17862) (IR17856)*
 - *Fixed robustness of in-band flash updates (UVDA IR17900) (IR17879)*
 - *Fixed admin password help text link on the GUI controller configuration page (IR17903)*
 - *Fixed SAS PHY link information display on GUI status page (IR17915)*
 - *Fixed username length validation during GUI login (IR17932)*
 - *Fixed location of tape device creation (IR17970)*
 - *Fixed task management processing with SpeedWrite enabled (IR17994)*
- **Version 2.10 (Released 5/4/17)**
 - **Release details**
 - *This release adds new improvements and fixes made during XstreamCORE product line development and testing. Increased stability and clean-up of incidents reported in the field are primary benefits of this release.*
 - **New and updated features**
 - *Added ECC error synchronization*

- *Added capability to see failure addresses during eCORE Control Engine timeout*
 - *Added true random number generator support*
 - *Added ability to pull-up board ID and NAND flash info*
 - *Updated SAS and Fibre Channel driver layers to latest available version*
 - *xCORE Acceleration Engine improvements*
 - *Added support for forcing FC and SAS chips into reset when ECC errors are detected*
 - *Improved DRAM handling and testing capabilities*
 - *Increased available command resources for xCORE*
 - *Reduced unnecessary resets of XstreamCORE board components*
 - *Enhanced performance monitoring features*
 - *Enhanced command handling*
 - *Improved PCIe read access handling and fixed PCIe streaming interface*
 - *Improved diagnostic for maximum delay tracking for PCIe read/write accesses.*
 - *Improved Fibre Channel routing*
 - *Fixed xCORE Acceleration Timeout errors*
 - *eCORE Control Engine improvements*
 - *Fixed temperature sensor issue*
- **Incident Fixes**
 - *Added user configurable SNTP server addresses (IR14305)*
 - *Fixed the Stop Identify GUI button from acting as a submit button (IR15619)*
 - *Fixed issue with Extended Copy commands that would cause a LUN to go into a busy state when a drive pulled before command issued (IR16346)*
 - *Fixed lack of retries for mode sense/select of SAS port mode page and lack of support for SAS-3 spec SAS port mode page (IR16483)*
 - *Fixed management port 2 not receiving DHCP address when cable connected after POST (IR17324)*
 - *Fixed extended POST xCORE register test failure and controller hang during ECC test (IR17327)*
 - *Fix SNMP traps not being sent when only management port 2 is connected (IR17344)*
 - *Fixed bridge LUN from being deleted during DeleteAllMaps CLI command (IR17358)*
 - *Fixed controller from being reserved after RestoreConfiguration CLI command issued with invalid parameters (IR17376)*
 - *Fixed failure to retrieve configuration via FTP and read buffer in certain configurations (IR17387)*
 - *Fixed some event log messages not being logged during POST (IR17388)*
- **Version 2.00 (Released 7/26/16)**
 - **Release details**
 - *ATTO has been actively investing in our Storage Controller product line to add value and feature sets to increase the viability and usability of the ATTO Storage Controller in today's competitive and demanding storage environments. Storage is currently moving toward a more open and modular architecture requiring those that build products within this market to adapt and address customer needs. Our latest feature set continues the path forward of a feature-rich hardware accelerated, open XstreamCORE Storage Controller.*
 - **New Features**
 - *XstreamVIEW Storage Manager GUI for configuration, management & monitoring*
 - *Update SasTargets to display SAS/SATA device firmware revision*
 - *Improved network traffic handling*
 - *Added "all" option to SASEnclosures output.*
 - *Improved Watchdog Timer functionality*
 - *Added additional diagnostic logging capabilities*
 - *Improved mode sense handling*
 - **Features**

- *Added ability to disable the Storage Controller LUN to allow discovery to complete without mapping the Storage Controller LUN*
 - *Updated the maximum temperature threshold to 90C and default warning at 80C*
- **Version 1.10**
 - **Release details**
 - *This release supports new diagnostic features for the 7500 platform*
 - *Added Fibre Channel and SAS Dynamic Trace Logging*
 - *Ethernet Trace Logging*
 - *xCORE Acceleration Engine Trace Logging*
- **Version 1.01**
 - **Release details**
 - *Added support for a full 240-drive configuration, 10 shelves of 24 drives each.*
- **Version 1.00**
 - **Initial Release Features**
 - **xCORE™ Data Acceleration** - *features multiple parallel I/O acceleration engines, end to end I/O processing, hardware buffer allocation management and real-time performance and latency analytics*
 - **eCORE™ Control Engine** - *adds common, open storage services, industry standard APIs, handles reservations, storage routing and host and LUN mapping functions*
 - - *Supports SAS 3Gb, 6Gb and 12Gb disk storage devices*
 - *Supports SATA 3Gb and 6Gb disk storage devices*
 - *Supports connection to 4Gb, 8Gb and 16Gb Fibre Channel*
 - *Drive Map Director™ feature provides predictive enclosure-aware mapping scheme*
 - *ExpressNAV™ System Manager GUI, CLI, FTP and Telnet access*
 - *Available FC and SAS port statistics*
 - *Available in-band access*
 - *SNMP Support*
 - *SMTP Support*

3. Known Issues/Advisements

Issues with an IR at the beginning are logged and tracked in the ATTO IR reporting process. These items are in review for a resolution in a future product release.

Issues

- IR16309 – Host Group rename command (HGRename) allows names that contain illegal characters (non-alpha numeric) and does not enforce the maximum string length (32) for Host Group names.
- IR16310 – Duplicate maps appear in RouteDisplay when SasMapByTopology is enabled, two drives are pulled from an SES-based JBOD enclosure, and one is re-inserted into the other pulled drive's slot.
- IR16311 – Drives are not visible in RouteDisplay when connected to NetApp JBOD DS2246 12Gb IOM shelves and SasMapByTopology is enabled.
- IR16410 - 7500 disappears when OSX 10.11 goes to sleep or hibernates until cable pull or FirmwareRestart.
- IR16688 – Changing the serial port baud-rate to a non-115200 bps speed will result in some boot up sequence messages to be corrupted.
- IR16689 – During a firmware update initiated from the GUI, navigation away from the firmware update page is not possible, and other browser connections to the GUI are not possible.
- IR16707 – Host group creation from the GUI will fail if the enter key is used to confirm the new host group.
- IR16944 – TCP transfers at 100Mb Ethernet speeds may be slow due to frequent resent packets.
- IR16982 – Issuing a Report Supported Operations Codes command may return duplicate op codes.
- IR17332 – A jump to zero exception is incorrectly reported as an unidentified instruction exception by the controller.

- IR17349 – Controller takes a long time to boot when a large number of drives are attached.
- IR17373 – Connecting shelves in series to form a dual-path loopback configuration from SAS ports A or B to SAS ports C or D may cause the controller to crash. Note: This issue has not been reproduced.
- IR17616 – Discovered chassis information is passed to an ESXi host, creating additional storage devices and LUN IDs in VMware.
- IR17858 – FCSFPIinfo only updates on FC link up (UVDA IR17863).
- IR17861 – If SAS tracing is enabled without SAS devices attached, the SAS trace file is unavailable (UVDA IR17958).
- IR17872 – The maximum number of FC initiators (32) may not be allowed to login to an FC port (UVDA IR17956).
-

Advisements

- In VMware environments, at least one drive must be present in the storage between the lun range of 0 – 7 (this can be confirmed by using RouteDisplay, visual confirmation of storage, or by using the IdentifyLun command). Otherwise, VMware will not continue its discovery scan to luns that are mapped above lun 7 and will not detect any drives. (This is a VMware issue and not an ATTO controller issue).
- Note that when you plug in a power cable to one of the power supplies on the 7500, power is immediately enabled on the controller, there is no power switch.
- The Drive Map Director™ feature requires that SAS enclosures support the SMP protocol, for specific information contact ATTO tech support, if enclosures do not support the SMP protocol then mapping occurs via the Automap feature.

4. Affected Products

Product Name	SKU
XstreamCORE FC 7500	XCFC-7500-002

5. Contacting ATTO Support

ATTO Technology, Inc. is renowned for its technical support services. ATTO's goal is to provide you the quickest response possible for your technical support needs, and is available Monday-Friday, 8:00 AM to 8:00 PM EST (except holidays and plant closings).

ATTO Technical Support can be contacted via phone or email:

- Phone: 716.691.1999 ext. 242
- E-Mail: techsupport@attotech.com